


EXPLODED VIEW & PARTS LIST

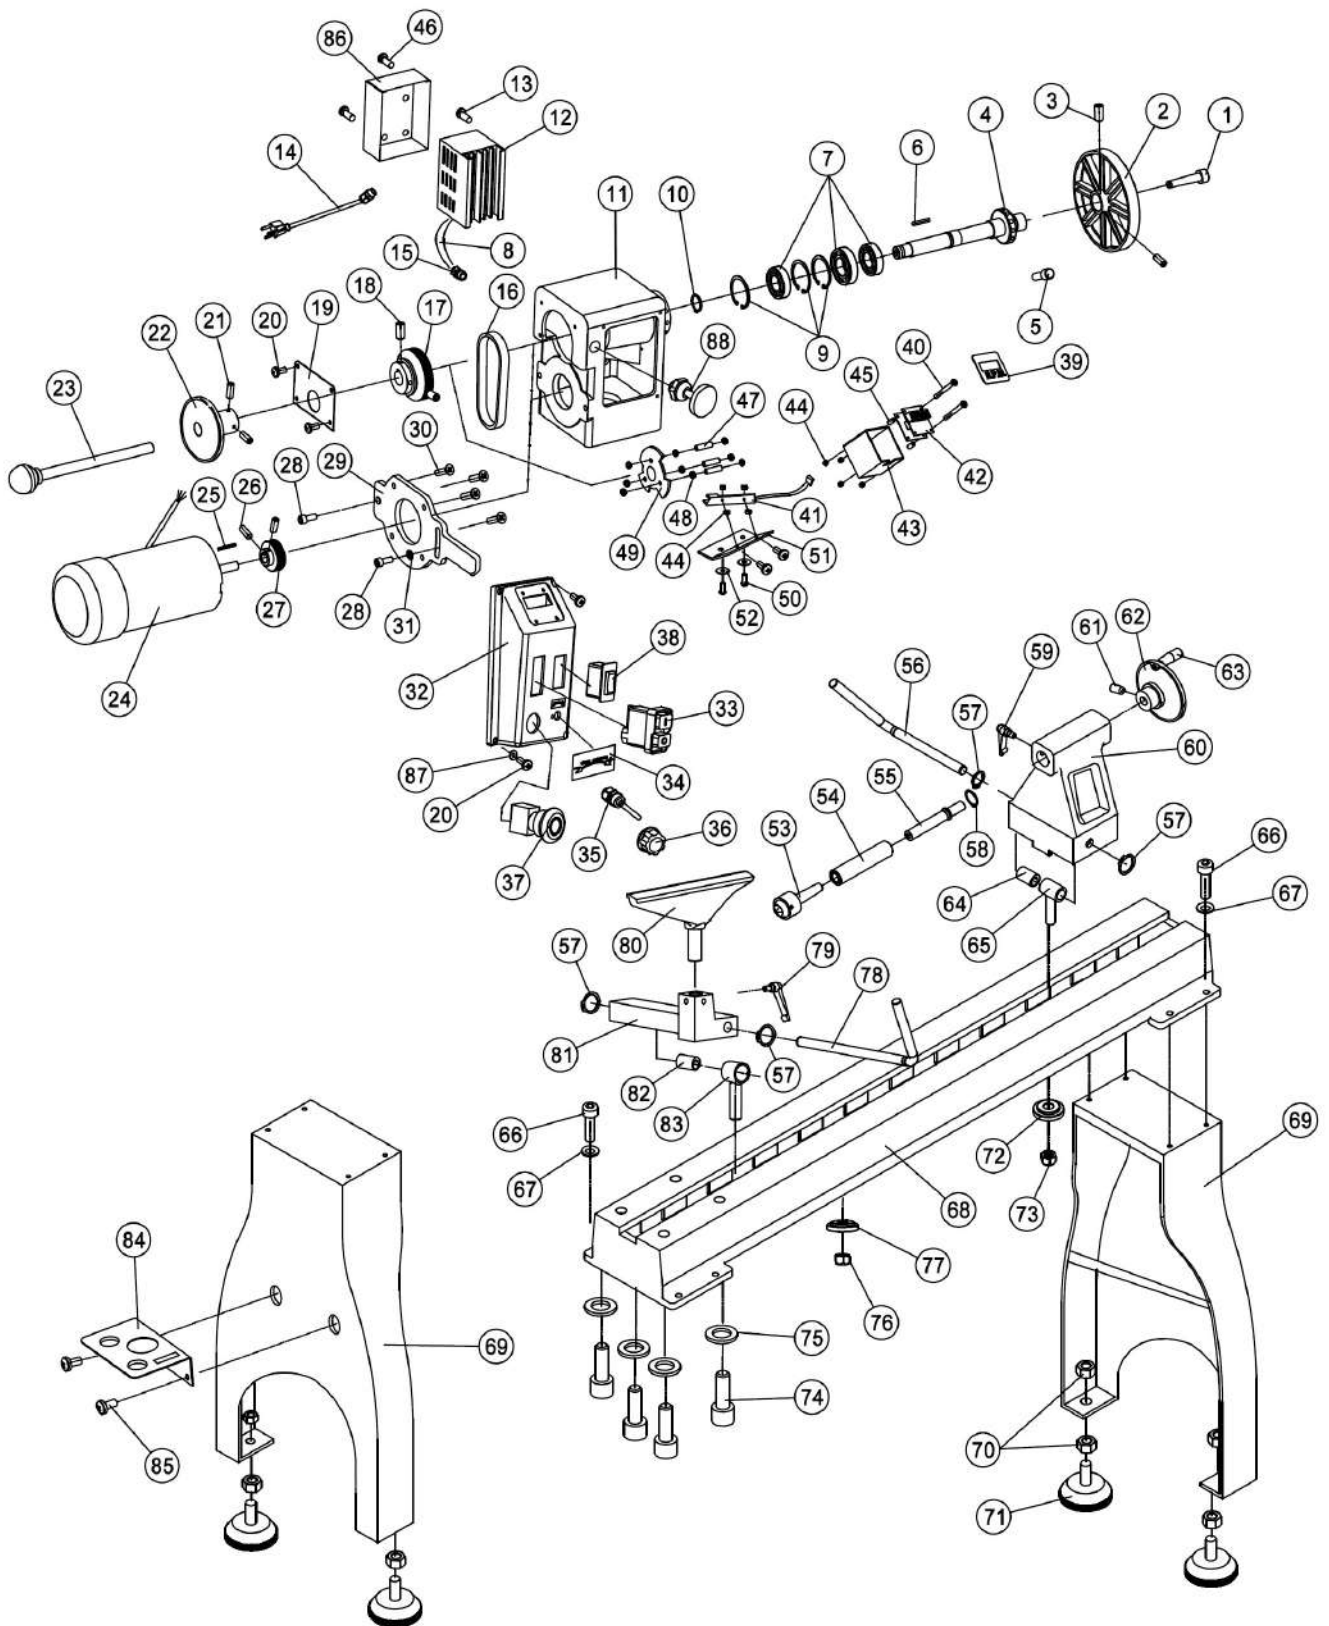

Part List for Wood Lathe

Index No.	Part No	Description	Size	Q'TY
1	DL356-001	Spur Center		2
2	DL356-002	Face Plate		1
3	DL356-003	Set Screw	M6x10	10
4	DL356-004	Spindle		1
5	DL356-005	Index Pin		1
6	DL356-006	Key	5x5x30	1
7	DL356-007	Ball Bearing	6205RZ	3
8	DL356-008	Cord –Inverter to Panel Plate		1
9	DL356-009	C-Ring	52	3
10	DL356-010	C-Ring	25	1
11	DL356-011	Headstock		1
12	DL356-012	Inverter		1
13	DL356-013	Hex Socket Cap Screw	M5x25	4
14	DL356-014	Power Cord		1
15	DL356-015	Strain Relief		1
16	DL356-016	Poly-V Belt	7PJ414	1
17	DL356-017	Spindle Pulley		1
18	DL356-018	Set Screw	M6x10	2
19	DL356-019	Cover Plate		1
20	DL356-020	Pan Head Machine Screw	M5x10	8
21	DL356-021	Set Screw	M8x10	2
22	DL356-022	Hand wheel for Spindle		1
23	DL356-023	Knockout Rob		1
24	DL356-024	Motor Assembly		1
25	DL356-025	Key	5x5x30	1
26	DL356-026	Set Screw	M8x10	2
27	DL356-027	Motor Pulley		1
28	DL356-028	Hex Socket Cap Screw	M8x25	2
29	DL356-029	Motor Assembly Plate		1
30	DL356-030	Cap Screw	M5x12	4
31	DL356-031	Flat Washer	8	2
32	DL356-032	Switch Box		1
33	DL356-033	Switch	DZ04-2B (dongke)	1
34	DL356-034	Speed Control Label		1
35	DL356-035	Variable Speed Control		1

Index No.	Part No	Description	Size	Q'TY
36	DL356-036	Variable Speed Knob		1
37	DL356-037	Push Button Switch		1
38	DL356-038	FWD/REV Switch	HY60B(KEDU)	1
39	DL356-039	RPM Label		1
40	DL356-040	Pan Head Machine Screw	M3x40	4
41	DL356-041	Sensor		1
42	DL356-042	Digital Readout		1
43	DL356-043	Digital Readout Box		1
44	DL356-044	Hex Nut	M3	4
45	DL356-045	Plastic Sleeve		4
46	DL356-046	Pan Head Machine Screw	M4x65	2
47	DL356-047	Set Screw	M5x20	3
48	DL356-048	Hex Nut	M5	6
49	DL356-049	Speed Readout Plate		1
50	DL356-050	Pan Head Machine Screw	M4x10	2
51	DL356-051	Plate for Sensor		1
52	DL356-052	Flat Washer	4	2
53	DL356-053	Center		1
54	DL356-054	Quill		1
55	DL356-055	Lead Screw		1
56	DL356-056	Lever for Tailstock		1
57	DL356-057	C-Ring	C-18	4
58	DL356-058	C-Ring	C-15	1
59	DL356-059	Tail Stock quill Handle		1
60	DL356-060	Tail Stock		1
61	DL356-061	Set Screw	M8x10	1
62	DL356-062	Hand wheel for Tailstock		1
63	DL356-063	Hand wheel Bar		1
64	DL356-064	Bushing for Tailstock		1
65	DL356-065	Clamp Bolt for Tailstock	M18x50	1
66	DL356-066	Hex Socket Cap Screw	M8x25	8
67	DL356-067	Lock Washer	8	8
68	DL356-068	Bed Way		1
69	DL356-069	Steel Stand		2
70	DL356-070	Hex Nut	M10	12
71	DL356-071	Adjustable Foot	M10x60	4
72	DL356-072	Clamp for tailstock		1
73	DL356-073	Hex Nut for tailstock	M18	1
74	DL356-074	Hex Socket Cap Screw	M8x25	8
75	DL356-075	Lock Washer	8	8
76	DL356-076	Lock Hex Nut	M18	1
77	DL356-077	Clamp for Tool Rest	M18x50	1
78	DL356-078	Lever for Tool Rest		1
79	DL356-079	Tool Rest Lock Handle	M10x25x80	1
80	DL356-080	Tool Rest		1
81	DL356-081	Tool Rest Base		1
82	DL356-082	Bushing for Tool Rest		1
83	DL356-083	Clamp Bolt for Tool Rest		1
84	DL356-084	Tool Bracket		1
85	DL356-085	Hex Socket Cap Screw	M10x16	2
86	DL356-086	Inverter Box		1
87	DL356-087	Flat Washer	5	4

Electrical Schematic-230V

